Tecnomac

The Tecnomac range of trolley blast chiller-freezers has a selection of integral and remote units based on both trolley capacity and chilling/freezing capability.

These models can take a range of gastronorm and baking trolleys as well as the extremely common Rational combi-oven trolleys. Additionally, the T30, T40 and T50 ranges can be passthrough for more efficient kitchen workflows.

With blasting chilling capability up to 270kg and blast freezing capability up to 250kg, this unit is perfect for large restaurants, bakeries, patisseries, hotels, hospitals, schools, nursing homes, food producers, government institutions and central production kitchens.

STANDARD FEATURES

HACCP internal data storage card with built in usb port •

OPTIONS

- Sterilizing ozone
- Water cooled condenser
- Version without condensing unit (*terms and conditions apply)
- Low noise condensing unit
- Additonal door
- Tropical rated condenser

DIMENSIONS

1780W x 1790D x 2330H mm

Minimum clearance at rear: 100mm

TROLLEYS

2 x Rational SCCWE201 combi-steamer or 2 x Rational SCCWE202 combi-steamer

415V / 3N / 50Hz / 31A 240V / 1N / 50Hz / 16A
9650W
29200W
R404A
270kg in 90 minutes
250kg in 240 minutes
580kg

SPECIFICATIONS ARE SUBJECT TO CHANGE WITHOUT NOTICE.

*Special Terms and Conditions - Supply of cabinet only Tecnomac and Comcater will only guarantee the correct functioning of the supplied cabinet. Excluded

dservice equipment

OMCATER


from any warranty is the following: 1. The cooling performance of the machine.

- 2. Malfunctioning or any damage to the cabinet which is caused by partial, incomplete or incorrect connection of the machine to the central cooling unit or the third party supplied compressor/ condensing unit.
- 3. Damage to the cabinet or property due to the failure to provide connection of the alarm input which stops the machine in case of the malfunctioning of the central cooling unit or the third party supplied compressor/condensing unit.
- 4. Damage caused through lack of commissioning of unit by a Comcater authorised service agent. 5. Service calls to any faults deemed to be caused by the third party refrigeration system


T50 / 270

TROLLEY BLAST CHILLER-FREEZERS



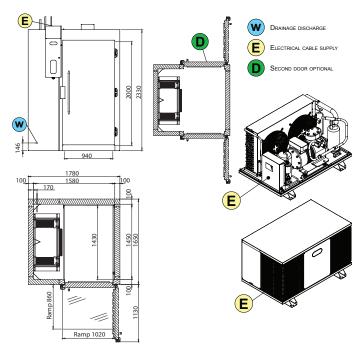

EXCAVATION For running , less than 16 hours a day

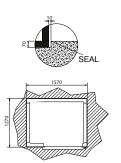

Sydney

20/4 Avenue of the Americas Newington, NSW 2127 Murarrie QLD 4172 Tel: +61 2 9748 3000 Tel: Fax: +61 7 3399 5311 Fax: +61 2 9648 4762

Brisbane 1/62 Borthwick Avenue

+61 7 3399 3122

Perth Unit 16, 7 Abrams Street Balcatta, WA 6021 Tel: +61 8 6217 0700

Fax: +61 8 6217 0799

National Head Office 156 Swann Drive Derrimut VIC 3030 +61 3 8369 4600 Tel: Fax: +61 3 8369 4699 www.comcater.com.au

Melbourne 96-100 Tope Street South Melbourne VIC 3205 +61 3 8369 4600 Tel: +61 3 8699 1299 Fax:

from the world of Comcater!

For running 24 hours a day Removable grate in stainless steel

40 7

Plastic Profiles

for air passage